## National Transportation Safety Board FACTUAL REPORT

NTSB ID: NYC95LA131 Aircraft Registration Number: N43705 Occurrence Date: 06/01/1995 Most Critical Injury: Serious Occurrence Type: Accident Investigated By: NTSB

Location/Time

Nearest City/Place State Zip Code Local Time Time Zone NY 14454 1430 **EDT GENESEO** Distance From Landing Facility: Airport Proximity: On Airport/Airstrip

Aircraft Information Summary

Aircraft Manufacturer Model/Series Type of Aircraft **TAYLORCRAFT** BC-12 /BC-12 Airplane

Revenue Sightseeing Flight: No

Air Medical Transport Flight: No

## Narrative

Brief narrative statement of facts, conditions and circumstances pertinent to the accident/incident:

\*\*\* Note: NTSB investigators may not have traveled in support of this investigation and used data provided by various sources to prepare this aircraft accident report. \*\*\*

On June 1, 1995, at 1430 eastern daylight time, a Taylorcraft BC-12, N43705, was substantially damaged during a forced landing after takeoff from the Geneseo Airport, Geneseo, New York. The private pilot was seriously injured and the passenger received minor injuries. Visual meteorological conditions prevailed, for the personal flight originating at Geneseo. No flight plan had been filed for the flight conducted under 14 CFR Part 91.

The pilot and passenger flew from Lancaster, New York, to the Geneseo Airport (D52), the day of the accident. While at D52, the pilot purchased auto fuel from a local vendor to refuel his airplane, and used plastic containers to transport the fuel. After about 45 minutes of ground time at D52, the pilot and passenger boarded the airplane for the return trip to Lancaster.

In the NTSB Form 6120.1/2, the pilot stated that he performed a soft field takeoff at D52, and during the initial climb the engine lost power. He then observed trees and power lines at the end of the runway, and elected to attempt a landing to the left of the runway.

The pilot further stated:

...Airplane proceeded to glide normally, then at approximately 100 feet, the nose of the dropped straight down and the aircraft plunged to the aircraft ground...

In a written statement, a witness to the accident said:

...I heard an aircraft engine miss. I looked north towards the runway and saw a blue and about 100 feet. It's engine quit, and it turned and white aircraft at dived vertically to the left, hitting the ground.

A Federal Aviation Administration Airworthiness Inspector examined the wreckage at the accident site. The Inspector's report stated that the airplane's three fuel tanks contained auto fuel, and the carburetor bowl contained water and sediment. The Inspector also examined the plastic containers used to transport the auto fuel to the airplane. His report stated, "...it appears the same sediments and water drained from the carburetor bowl were found in the plastic containers..."

National Transportation Safety Board

NTSB ID: NYC95LA131

FACTUAL REPORT	Occurrence Date: 06/01/1995											
AVIATION	Occurrence Type: Accident											
Landing Facility/Approach Inform	nation											
Airport Name	Air	port ID:	Airport Elevation	Run	way Used	Runwa	y Length	n Ru	inway Width			
GENESEO D			52	560 Ft. MSI	MSL 23 4695		4695	90		)		
Runway Surface Type: Grass/turf		•		•	•				•			
Runway Surface Condition: Dry												
Approach/Arrival Flown: NONE												
VFR Approach/Landing: Forced Land	ing											
Aircraft Information												
Aircraft Manufacturer TAYLORCRAFT			Model/ BC-1	/Series 2 /BC-12				Serial N 7364	ll Number 4			
Airworthiness Certificate(s): Normal			<u>'</u>									
Landing Gear Type: Tailwheel			_									
Amateur Built Acft? No Nur	mber of Seats: 2		Certified Max Gross Wt. 1200 LBS						Number of Engines: 1			
Engine Type: Reciprocating				Engine Manufacturer: Model/Series: A-65-8						Rated Power: 65 HP		
- Aircraft Inspection Information												
Type of Last Inspection		Da	Date of Last Inspection Time Si			nce Last Inspe	ection	Airframe	Total Time			
Annual		0	7/1994				94 Ho	urs		Hours		
- Emergency Locator Transmitter (ELT)	Information											
ELT Installed?/Type Yes /		El	_T Opera	ted? No	d? No ELT Aided in Locating Accident Site?							
Owner/Operator Information												
Registered Aircraft Owner			Street A	Address 3421 ZOELL	FR ROA	AD.						
BERNARD CHESNA				City						Zip Code 14004		
			Street A	ddress					NY	111001		
Operator of Aircraft 3421 ZOELLER ROAD									Ct-1-	Tie Oal		
BERNARD CHESNA								State NY	Zip Code 14004			
Operator Does Business As:					0	perator Desigr	nator Co	de:				
- Type of U.S. Certificate(s) Held: None	<del>}</del>											
Air Carrier Operating Certificate(s):												
Operating Certificate:	Operating Certificate: Operator Certificate:											
Regulation Flight Conducted Under: Pa	art 91: General	Aviation	1									
Type of Flight Operation Conducted: Pe	ersonal											
	F.	ACTUA	L REPO	RT - AVIATION						Page 2		

National Transportation Safety Board
FACTUAL REPORT
AVIATION

NTSB ID: NYC95LA131

Occurrence Date: 06/01/1995

	AVIATI	Occurrence Type: Accident												
First Pilot	Information													
Name						City	ty			5	State	Date	e of Birth	Age
					On File				c	n File			70	
Sex: M Seat Occupied: Left Occupational Pilot? Retired Certif									Certific	cate Num	nber:			
Certificate(	s): Priva	ate												
Airplane Ra	ating(s): Sing	le-engine L	and											
Rotorcraft/0	Glider/LTA: None	e												
Instrument Rating(s): None														
Instructor F	Rating(s): None	е												
Current Bie	nnial Flight Revie	ew?												
Medical Ce	rt.: Class 3	Medica	al Cert. Status	s: Valid Me	dicalno w	aivers	/lim.		Date	of Last	Medical	Exam:	: 11/1993	
- Flight Tim	Flight Time Matrix  All A/C  This Make and Model s		Airplane Single Engine	Airplane Mult-Engine	Night		In Actual	Instrument		Rotorcraft		Glider	Lighter Than Air	
Total Time		402	183	402			8							
Pilot In Cor	nmand(PIC)	402	183	402			8					_		
Instructor						-			_		-	-		
Instruction		67	24	00		-						$\dashv$		
Last 90 Day		67 20	31 17	98		+						$\dashv$		
Last 30 Da		20	2	20		+			+		-	$\dashv$		
	Seatbelt Used? Yes Shoulder Harness Used? No						Toxico	logy Perf	rformed? No Second Pilot? No					)
Flight Pla	n/Itinerary													
	ght Plan Filed: No	one												
Departure Point							State	Ai	rport Ide	port Identifier Departure T			Time	Time Zone
Same as Accident/Incident Location								D	D77		1430			EDT
Destination							State	A	rport Ide	port Identifier				
LANCASTER							NY	D77						
Type of Cle	earance: None							•			•			
Type of Air	space: Class	G												
Weather	Information													
Úa∥io©ÁSou	rce of Wx Informa	ation:												
	TV/Ra	dio Weathe	r											
				FACTUAL	. REPORT	- AVI	ATION	1						Page 3

National Transportation Safety Board
FACTUAL REPORT

NTSB ID: NYC95LA131

Occurrence Date: 06/01/1995

AVIATION				currence Type	: Accide	nt			
Weather	Information								
WOF ID	Observation Time	Time Zone	WOF	Elevation	WOF D	istance From Ad	ccident Site		Direction From Accident Site
	0000			0 Ft. MSL			0 NM		0 Deg. Mag.
Sky/Lowes	st Cloud Condition: Clea	ar				0 Ft. AGL	Condition of	of Light	:: Day
Lowest Ce	iling: None			0 Ft. AGL	Visib	oility: 10	) SM	Altim	neter: "Hg
Temperatu	ure: 24 °C	Dew Point:		°C Wea	ther Cond	itions at Accider	nt Site: Visual	Condi	tions
Wind Direc	ction: Variable	Wind Sp	eed: Calm		Win	d Gusts:			
Visibility (F	RVR): 0 Ft.	Visibility	(RVV)	0 SM					
Precip and	d/or Obscuration:	•			•				
Accident	Information								
Aircraft Damage: Substantial				raft Fire: Non	<u> </u>		Aircraft Exp	olosion	None
- Injury Su	mmary Matrix	Fatal	Serious	Minor	None	TOTAL			
First Pi	-		1			1			
Second	d Pilot								
Studen	nt Pilot								
Flight I	nstructor								
Check	Pilot								
Flight E	Engineer								
Cabin /	Attendants								
Other 0	Crew								
Passer	ngers			1		1			
- TOTAL A	ABOARD -		1	1		2			
Other (	Ground	0	0	0		0			
- GRANE	TOTAL -	0	1	1		2			

National Transportation Safety Board

## FACTUAL REPORT AVIATION

NTSB ID: NYC95LA131

Occurrence Date: 06/01/1995

Occurrence Type: Accident

istrative	

Investigator-In-Charge (IIC)

ROBERT L. PEARCE

Additional Persons Participating in This Accident/Incident Investigation:

PEDRO L MUNOZ ROCHESTER, NY